

2004 Ford Mustang V8-4.6L SOHC VIN X

Vehicle > Technical Service Bulletins

STEERING - SQUEAK/CREAK NOISE WHILE TURNING

TSB 05-14-3

07/25/05

SQUEAK/CREAK NOISE FROM STEERING RACK
WHEN TURNING

FORD:

2002-2004 Mustang

This article supersedes TSB 04-24-8 to update the Action.

ISSUE

Some 2002-2004 Mustang vehicles may exhibit a squeak or creak type noise when turning.

ACTION

Replace both power steering gear tube brackets.

Refer to Workshop Manual Section 211-02 Steering Gear Mounting. Tighten the steering gear mounting fasteners to 52 lb-ft (70 N.m).

PART NUMBER	PART NAME
E5DZ-3K620-A	Bracket

Parts Block

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

OPERATION DESCRIPTION TIME 051403A 2002-2004 Mustang 0.8 Hr. Replace Power Steering Gear Tube Bracket
(Do not use with 3504A)

DEALER CODING

CONDITION BASIC PART NO. CODE 3K620 16

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle.

Disclaimer