

2017 Ford Mustang V8-5.0L

Vehicle &gt; Technical Service Bulletins

## MANUAL TRANSMISSION - NO CRANK - BUILT ON OR BEFORE 6/15/2016

TSB 16-0103	MANUAL TRANSMISSION - NO CRANK - BUILT ON OR BEFORE 6/15/2016
<b>Publication Date: August 10, 2016</b>	

**FORD:** 2015-2017 Mustang**ISSUE:**

Some 2015-2017 Mustang vehicles equipped with a manual transmission and built on or before 6/15/2016 may exhibit a no crank condition due to the clutch pedal position (CPP) switch being damaged.

**ACTION:**

Follow the Service Procedure steps to correct the condition.

**SERVICE PROCEDURE**

1. Inspect the CPP switch for physical damage. Is the CPP switch damaged?
  - a. Yes - proceed to Step 2.
  - b. No - this article does not apply.
2. Install a new CPP switch and bracket. Refer to Workshop Manual (WSM), Section 303-14. The switch includes a plastic bracket rotating the connector 90 degrees. (Figure 1)

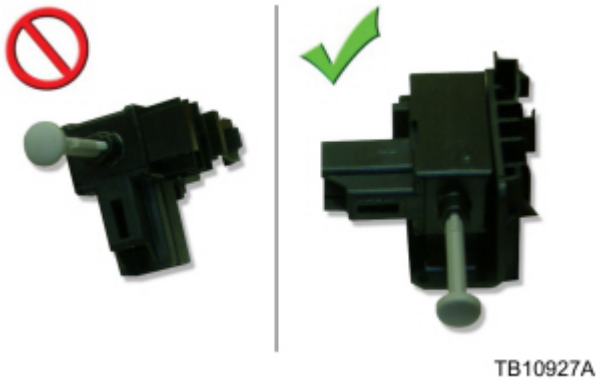


Figure 1 - 16-0103

PART NUMBER	PART NAME
HR3Z-11A152-A	Clutch Pedal Switch

OPERATION	DESCRIPTION	TIME
160103A	2015-2017 Mustang Manual Transmission: Inspect And Replace The CPP Switch And Bracket (Do Not Use With Any Other Labor Operations)	0.3 Hr.

# WARRANTY STATUS

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage.

Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

# DEALER CODING

BASIC PART NO.	CONDITION CODE
11A152	01

---

**NOTE:** The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.

Copyright © 2016 Ford Motor Company