

2019 Ford Mustang V8-5.0L

Vehicle > Technical Service Bulletins

5.0L - ILLUMINATED MALFUNCTION INDICATOR LAMP (MIL) WITH DIAGNOSTIC TROUBLE CODES (DTCS) P0390 AND/OR P0394

TECHNICAL SERVICE BULLETIN
 5.0L - ILLUMINATED MALFUNCTION
 INDICATOR LAMP (MIL) WITH
 DIAGNOSTIC TROUBLE CODES (DTCS)
 P0390 AND/OR P0394

18-2360

03 December 2018

Model:

Ford
2018 F-150
2018-2019 Mustang

Issue: Some 2018 F-150 and 2018-2019 Mustang vehicles equipped with a 5.0L engine may exhibit an illuminated MIL with DTCs P0390 and/or P0394 stored in the powertrain control module (PCM).

Action: Follow the Service Procedure steps to correct the condition.

Parts

Part Number	Description	Quantity
HL3Z-6M280-A	Exhaust VCT Oil Control Solenoid	1
JL3Z-6584-D	Valve Cover Gasket (Left Side)	1
HL3Z-6C535-A	Valve Cover Spark Plug Seal	1
BR3Z-6C535-A	VCT Solenoid Valve Cover Seal	1
W712334-S440	Strut Tower Brace Nut	4
TA-30	Motorcraft® Silicone Gasket and Sealant	1
ZC-30-A	Motorcraft® Silicone Gasket Remover	1
ZC-31-B	Motorcraft® Metal Surface Prep Wipes	1
PM-4-A	Motorcraft® Metal Brake Parts Cleaner (All Markets Except Canada)	1
PM-4-B	Motorcraft® Metal Brake Parts Cleaner (Canada Only)	1

Warranty Status: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2018 F-150 5.0L Engine: Retrieve DTCs And Replace The Bank 2 Exhaust VCT Oil Control Solenoid (Do Not Use With Any Other Labor Operations)	182360A	1.3 Hrs.

2018-2019 Mustang 5.0L Engine: Retrieve DTCs And Replace The Bank 2 Exhaust VCT Oil Control Solenoid (Do Not Use With Any Other Labor Operations)	182360B	2.0 Hrs.
---	---------	-------------

Repair/Claim Coding

Causal Part:	6M280
Condition Code:	42

Tool List - All Models

Drive	Tool Name
1/4"	Power Tool
1/4"	Torque Wrench
1/4"	Ratchet
1/4"	7 mm Deep Socket
1/4"	8 mm Deep Socket
1/4"	10 mm Deep Socket
	Trim Tool
	Plastic Scraper
	Blow Gun
	Essential Special Service Tool 205-142
	Essential Special Service Tool 205-153
	Essential Special Service Tool 303-1247

Tool List - Mustang Only Additional Tools

Drive	Tool Name
3/8"	Power Tool
3/8"	Torque Wrench
3/8"	Ratchet
3/8"	10 mm Deep Socket
3/8"	13 mm Deep Socket
3/8"	15 mm Deep Socket
	Pocket Screwdriver
	2 Jaw Puller

SERVICE PROCEDURE

1. Using the appropriate Ford diagnostic scan tool or equivalent, retrieve DTCs. Are DTCs P0390 and/or P0394 the only DTCs stored in the PCM?

(1). Yes - proceed to Step 2.

(2). No - this article does not apply. Refer to the Powertrain Controls/Emissions Diagnosis (PC/ED) Manual for normal diagnostics.

2. Replace the bank 2 exhaust variable camshaft timing (VCT) oil control solenoid. Refer to Workshop Manual (WSM), Section 303-14.

© 2018 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.