

1999 Ford Mustang GT V8-4.6L SOHC VIN X

Vehicle > Technical Service Bulletins

## WINDSHIELD - WATER LEAKS

Article No.

99-2-3

^ WATER LEAKS - WINDSHIELD SEALING - SERVICE TIP

^ WINDSHIELD - SEALING - SERVICE TIP

FORD:

1995-97 PROBE, THUNDERBIRD

1995-99 CONTOUR, CROWN VICTORIA, ESCORT, MUSTANG, TAURUS

LINCOLN-MERCURY:

1995-97 COUGAR

1995-98 MARK VIII

1995-99 CONTINENTAL, GRAND MARQUIS, MYSTIQUE, SABLE, TOWN CAR, TRACER

LIGHT TRUCK:

1995-97 AEROSTAR, F SUPER DUTY

1995-99 ECONOLINE, EXPLORER, F-150, F-250 HD, F-250 LD, F-350, RANGER, VILLAGER, WINDSTAR

1997-99 EXPEDITION, MOUNTAINEER

1998-99 NAVIGATOR

1999 SUPER DUTY F SERIES

ISSUE

The customer may report a water leak from the windshield. This may be caused by a skip or a void in the production sealer somewhere around the periphery of the windshield.

ACTION

Apply a bead of Liquid Butyl Sealer (F8AZ-19554-CA) under the weatherstrip around the periphery of the windshield. Refer to the appropriate Service or Workshop Manual for weatherstrip removal where necessary.

**NOTE**

DUE TO DIFFICULTY IN DETERMINING THE EXACT LOCATION OF A WATER LEAK, IT MAY BE IDEAL TO SEAL THE ENTIRE WINDSHIELD PERIPHERY (SIDES, TOP AND BOTTOM) TO ENSURE REPAIR OF THE LEAK.

WINDSHIELD SEALING LABOR TIMES		
Model	Year	Time
Continental	1995-99	0.9
Contour/Mystique	1995-99	0.8
Crown Victoria/Grand Marquis	1995-99	0.9
Escort/Tracer	1995-99	0.9
Mark VIII	1995-98	0.9
Mustang	1995-99	1.3
Probe	1995-97	0.9
Taurus/Sable	1995-99	0.9
Thunderbird/Cougar	1995-97	0.9
Town Car	1995-99	0.9
Aerostar	1995-97	0.9
Econoline	1995-99	0.9
Expedition/Navigator	1997-99	0.9
Explorer/Mountaineer	1995-99	0.9
F-Series	1995-99	0.9
Ranger	1995-99	0.9
Villager	1995-99	1.1
Windstar	1995-99	0.9

The following is the labor operation to be used for this repair and a chart providing Windshield Sealing Labor Times:

^ 03100B

PART NUMBER PART NAME F8AZ-19554-CA Liquid Butyl Sealer

OTHER APPLICABLE ARTICLES: NONE

WARRANTY STATUS: INFORMATION ONLY

OASIS CODES: 102000, 110000