

**AIR BAG WARNING LAMP ON—DTC B1891 IN
RESTRAINTS CONTROL MODULE OR LAMP
FLASHES CODE 53—VEHICLES BUILT BEFORE
10/02/2004**

TSB 05-6-15

FORD:

2005 Mustang

ISSUE

Some 2005 Mustang vehicles built before 10/02/2004, may exhibit the air bag warning lamp on with diagnostic trouble code (DTC) B1891 or the lamp flashes code 53 (Air Bag Tone Warning Indicator Shorted To Voltage). The restraint system remains fully functional.

ACTION

It may be necessary to replace the instrument cluster. Refer to the following Service Procedure.

SERVICE PROCEDURE

1. Refer to Workshop Manual Section 501-20B (Supplemental Restraint System Diagnosis And Testing) and follow pinpoint test "F".
 - a. If NO short to battery is found on the air bag tone warning indicator circuit, proceed to TSB Step 2. DO NOT replace the restraints control module.
 - b. If a short to battery is found, repair as needed and do not continue with this TSB.

2. If no short to battery was found in TSB Step 1, install new instrument cluster per Workshop Manual Section 413-01 (Removal And Installation Of Instrument Cluster). Verify that the air bag warning lamp proves out after installation of the new cluster.

NOTE

ORDER THE NEW INSTRUMENT CLUSTER PER PROCEDURES IN THE WARRANTY AND POLICY MANUAL, SECTION 3.

PART NUMBER	PART NAME
-10849-	Cluster

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage

DEALER CODING

BASIC PART NO.
10849

CONDITION
CODE
42

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.