

FORD:
2005-2007 Mustang

This article supersedes TSB **06-22-16** to update the Parts List.

ISSUE

Some 2005-2007 Mustang vehicles built before 10/11/2006 and equipped with a convertible top could develop wear or a hole near the 4th bow and/or number 1 bow area. This is caused by the number 1 and number 4 bow wearing or pinching through the vinyl or cloth top.

ACTION

Follow the Service Procedure steps to correct the condition.

SERVICE PROCEDURE

1. Install a new convertible top cover.
2. Install two (2) tether straps.
3. Add tape to the number 1 bow panel following the instruction sheet provided in the Convertible Top Kit.

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage
IMPORTANT: Warranty coverage limits/policies are not altered by a TSB. Warranty coverage limits are determined by the identified causal part.

OPERATION	DESCRIPTION	TIME
071901A	2005-2007 Mustang Convertible: Replace Convertible Top Cover Includes Time To Install Tether Straps, And To Remove And Install Top Assembly (Do Not Use With 52700A, 53000A)	4.4 Hrs.

DEALER CODING

BASIC PART NO.
7652700

CONDITION CODE
30

PART NUMBER	PART NAME
7R3Z-76539B40-BA	Convertible Top Kit - (Black Vinyl)
7R3Z-76539B40-BB	Convertible Top Kit - (Camel Vinyl)
7R3Z-76539B40-AD	Convertible Top Kit - (Black Cloth)

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.