

Door Chime Repair



Over time the foam surround on the speaker inside the 1991 and 1992 Mustang's door chime module disintegrates and the chime module gets quiet or stops working altogether. This kit uses a o'ring of the right size and stiffness to restore the volume of your door chime. Includes detailed instructions.

- Restores 1990-1991 Mustang door chime volume
- Includes detailed instructions



Video

Use your smart phone's camera app to scan the QR code to the left to watch a video detailing this product.


Step 1

The door chime module on 1990-1991 Mustangs is under the dashboard near the steering column. Locate, unplug, and remove it from the car.




Step 2

Use a small screwdriver to open the module case.

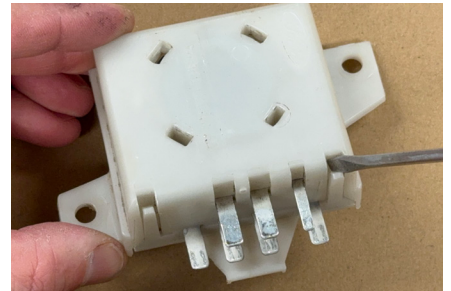

Step 3

Disassemble the module.

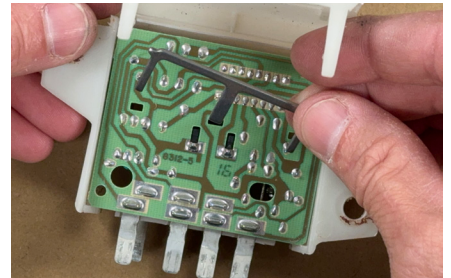

Step 4

Use a small screwdriver to release the tabs on the speaker frame and remove the speaker disc.



Step 5

Scrape what remains of the foam speaker surround with a razor blade. Reinstall the speaker disk.



Step 6

Install the included o-ring over the speaker disc and reassemble the module

